



NUMBER: 11-001-15

GROUP: Exhaust System

DATE: January 28, 2015

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

SUBJECT:

Sputter Type Noise Emitted From Exhaust

OVERVIEW:

This bulletin involves inspecting and replacing the resonator if required.

MODELS:

2014 - 2015 (KL) Jeep Cherokee

NOTE: This bulletin applies to vehicles built on or before October 14, 2014 (MDH 1014XX) equipped with 2.4L I4 Multiair Engine (sales code ED6 or ED8) or 3.2L V6 24V VVT Engine (sales code EHB).

SYMPTOM/CONDITION:

The customer may notice a sputter type noise coming from under the vehicle.

DIAGNOSIS:

If the customer describes the symptom/condition above, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1 (AR)	68185925AD	Resonator, FWD 3.2L (EHB) or 2.4 (ED6 or ED8)
1 (AR)	68185926AD	Resonator, AWD/4WD 3.2L (EHB) or 2.4L (ED6 or ED8)

REPAIR PROCEDURE:

1. Inspect the resonator for drain holes, see (Fig. 1).

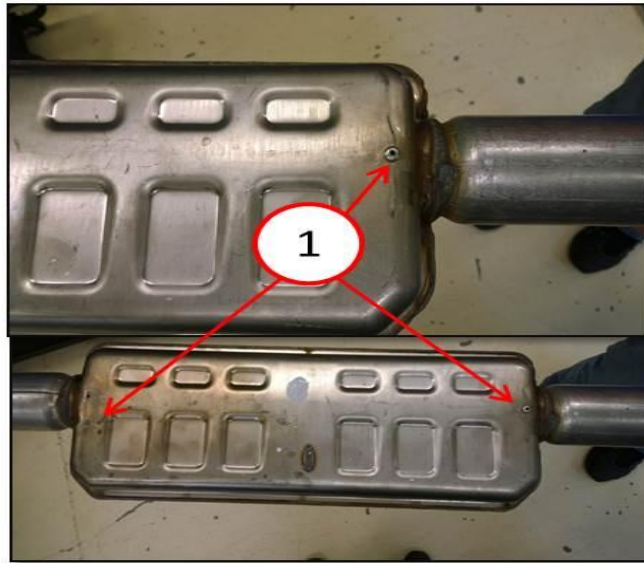


Fig. 1 Resonator Drain Hole

1 - Drain holes are located on both ends of the resonator.

2. Does the resonator have drain holes?
 - a. Yes >>> Proceed to [Step #3](#).
 - b. No >>> This bulletin doesn't apply. Normal diagnostics should be performed.
3. Replace the resonator, refer to the procedures available in DealerConnect> TechConnect> Service Info> 11 - Exhaust System Resonator, Exhaust/Removal/Installation.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
11-20-01-97	Resonator - Replace (1 - Semi-Skilled)	08- Engine Performance	0.4 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------